

# WFS3-40B41CA00

WFS

**FORK SENSORS** 





## Ordering information

Туре	Part no.
WFS3-40B41CA00	6058649

Other models and accessories → www.sick.com/WFS

Illustration may differ



#### Detailed technical data

#### **Features**

Functional principle	Optical detection principle
Dimensions (W x H x D)	10 mm x 25 mm x 64.3 mm
Fork width	3 mm
Fork depth	42 mm
Minimum detectable object (MDO)	Gap between Labels / Size of labels: 2 mm <sup>1)</sup>
Label detection	✓
Adjustment	Teach-in button, cable (Teach-in, sensitivity, light/dark switching, key lock, Teach-in dynamic)
Teach-in mode	1-point teach-in 2-point teach-in Teach-in dynamic

<sup>1)</sup> Depends on the label thickness.

#### Mechanics/electronics

Current consumption	20 mA <sup>1)</sup>
Stability of response time	± 20 µs
Jitter	17 μs
Switching output	Push-pull: PNP/NPN
Switching output (voltage)	Push-pull: PNP/NPN High = $U_V - < 2 \text{ V/Low}$ : $\leq 2 \text{ V}$
Switching mode	Light/dark switching
Output current I <sub>max.</sub>	100 mA
Input, teach-in (ET)	Teach: U > 5 V $<$ U <sub>V</sub> Run: U $<$ 4 V

<sup>1)</sup> Without load.

Initialization time	40 ms
Time delay	Switch-off delay, 0 ms / 8 ms / 16 ms / 32 ms / 65 ms / 130 ms / 260 ms / 520 ms, adjustable via IO-Link (0 ms = default)
Connection type	Male connector M8, 4-pin
Circuit protection	U <sub>V</sub> connections, reverse polarity protected Output Q short-circuit protected Interference pulse suppression
Weight	Approx. 36 g
Housing material	Plastic, PA (glass-fiber reinforced)

<sup>1)</sup> Without load.

# Safety-related parameters

MTTF <sub>D</sub>	97 years
<b>DC</b> <sub>avg</sub>	0 %

#### Communication interface

IO-Link	<b>√</b> , IO-Link V1.1
VendorID	26
DeviceID HEX	8000AE
DeviceID DEC	8388782
Cycle time	2.3 ms
Process data structure A	Bit 0 = switching signal $Q_{L1}$ Bit 1 = switching signal $Q_{L2}$ Bit 2 = not used Bit 3 = Teach busy Bit 4 15 = empty
Process data structure B	Bit 0 = switching signal Q <sub>L1</sub> Bit 1 = Quality of Run Alarm  Bit 2 = not used  Bit 3 = Teach busy  Bit 4 15 = empty
Process data structure C	Bit 0 = switching signal $Q_{L1}$ Bit 1 = switching signal $Q_{L2}$ Bit 2 = not used Bit 3 = Teach busy Bit 4 5 = empty Bit 6 15 = measuring value
Process data structure D	Bit 0 = switching signal Q <sub>L1</sub> Bit 1 = Quality of Run Alarm  Bit 2 = not used  Bit 3 = Teach busy  Bit 4 5 = empty  Bit 6 15 = measuring value

#### Ambient data

Shock load	According to EN 60068-2-27
UL File No.	NRKH.E191603

#### Smart Task


Smart Task name	Base logics
-----------------	-------------

#### Classifications

ECLASS 5.0	27270909
------------	----------

ECLASS 5.1.4	27270909
ECLASS 6.0	27270909
ECLASS 6.2	27270909
ECLASS 7.0	27270909
ECLASS 8.0	27270909
ECLASS 8.1	27270909
ECLASS 9.0	27270909
ECLASS 10.0	27270909
ECLASS 11.0	27270909
ECLASS 12.0	27270909
ETIM 5.0	EC002720
ETIM 6.0	EC002720
ETIM 7.0	EC002720
ETIM 8.0	EC002720
UNSPSC 16.0901	39121528


### Dimensional drawing (Dimensions in mm (inch))

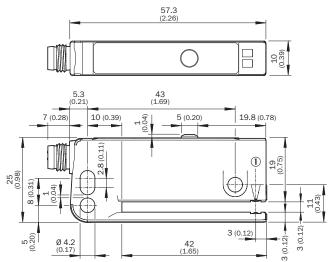

① Optical axis

### Adjustments

Adjustment: teach-in via Teach-in button (WFxx-B41Cxx)



- $\textcircled{1} \ \ \textbf{Function signal indicator (yellow), switching output}$
- ② Function signal indicator (green)
- ③ Teach-in button and function button

## Connection diagram


Cd-273

$$\begin{array}{c|c} & BN & 1 \\ \hline & 1 \\ \hline & 1 \\ \hline & 1 \\ \hline & & 1 \\ \hline & 1 \\ \hline$$

#### Concept of operation


Teach-in dynamic via Teach-in button

# 1. Start teach-in: Position carrier or label between the fork

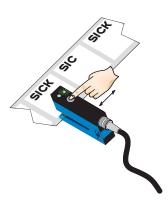

Press the teach-in button for 3 - 20 s. With the pushbutton pressed down, move several label with carrier material (label) through the sensor. The yellow LED flashes at 3 Hz during the teach-in procedure. Recommendation: Move at least 3 label + carrier through the sensor.

#### 2. End teach-in:

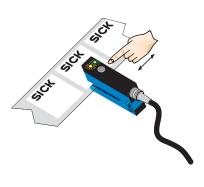

Release the teach-in button for <  $20 \, \text{s}$ . If teach-in is successful, the function indicator (yellow LED) directly indicates the output state of the sensor. The switching threshold is now optimally set between carrier and label. The best possible operational safety is provided.

#### Note

#### Fine adjustment

In order to obtain a higher operating reserve, a fine adjustment can be carried out after successful teach-in. For this purpose, the switching threshold is set close to the taught-in object. The teach-in button must be pressed and released within 10 s of successful teach-in. Successful setting is signaled by flashing twice at 1 Hz.

#### Light/dark switching



You can change between light switching and dark switching by pressing the teach-in button for 20 - 30 s.

#### **Pushbutton lock**



The device can be locked against unintended operation by pressing the teach-in button for > 30 s. The device can be unlocked by pressing the teach-in button again for > 30 s.

#### Recommended accessories

Other models and accessories → www.sick.com/WFS

	Brief description	Туре	Part no.
Cloning mod	ules		
SICK  The state of	IO-Link version V1.1, Port class 2, PIN 2, 4, 5 galvanically connected, Supply voltage 18 V DC 32 V DC (limit values, operation in short-circuit protected network max. 8 A)	IOLP2ZZ-M3201 (SICK Memory Stick)	1064290
	IO-Link V1.1 Class A port, USB2.0 port, optional external power supply 24V $/$ 1A	IOLA2US-01101 (SiLink2 Master)	1061790
	EtherCAT IO-Link Master, IO-Link V1.1, Port Class A, power supply via $7/8$ " cable 24 V / 8 A, fieldbus connection via M12 cable	IOLG2EC-03208R01 (IO-Link Master)	6053254
Jniversal bar	r clamp systems		
	WFS mounting rod, straight, including 2 x fixing screws, Aluminum	BEF-M12GF-A	2059414
00	Bar clamp for bar diameter of 12 mm (fixing the mounting rod), Aluminum, 2 screws M6 x 30, 2 spring discs	BEF-RMC-D12	5321878
	<ul> <li>Connection type head A: Male connector, M8, 4-pin, straight</li> <li>Description: Unshielded</li> <li>Connection systems: Screw-type terminals</li> <li>Permitted cross-section: 0.14 mm² 0.5 mm²</li> </ul>	STE-0804-G	6037323
	<ul> <li>Connection type head A: Female connector, M8, 4-pin, straight, A-coded</li> <li>Connection type head B: Flying leads</li> <li>Signal type: Sensor/actuator cable</li> <li>Cable: 5 m, 4-wire, PVC</li> <li>Description: Sensor/actuator cable, unshielded</li> <li>Application: Zones with chemicals</li> </ul>	YF8U14- 050VA3XLEAX	2095889
<b>R R</b>	<ul> <li>Connection type head A: Female connector, M8, 4-pin, straight, A-coded</li> <li>Connection type head B: Male connector, M12, 4-pin, straight, A-coded</li> <li>Signal type: Sensor/actuator cable</li> <li>Cable: 5 m, 4-wire, PVC</li> <li>Description: Sensor/actuator cable, unshielded</li> <li>Application: Zones with chemicals</li> </ul>	YF8U14- 050VA3M2A14	2096609
Sensor Integ	ration Gateway		
	<ul> <li>Further functions: Web server integrated, USB connection for easy configuration of the SIG200 Sensor Integration Gateway with SOPAS ET, the engineering tool from SICK, logic editor is available for easy configuration of logic functions</li> <li>Connection CONFIG: 1 x M8, 4-pin female connector, USB 2.0 (USB-A)</li> <li>Logic editor: yes</li> <li>Communication interface: IO-Link, USB, Ethernet, PROFINET, REST API</li> <li>Product category: IO-Link Master</li> </ul>	SIG200-0A0412200	1089794
	<ul> <li>Further functions: Web server integrated, USB connection for easy configuration of the SIG200 Sensor Integration Gateway with SOPAS ET, the engineering tool from SICK, logic editor is available for easy configuration of logic functions</li> <li>Connection CONFIG: 1 x M8, 4-pin female connector, USB 2.0 (USB-A)</li> <li>Logic editor: yes</li> <li>Communication interface: IO-Link, USB, Ethernet, REST API</li> <li>Product category: IO-Link Master</li> </ul>	SIG200-0A0G12200	1102605

# WFS3-40B41CA00 | WFS

FORK SENSORS

#### Recommended services

Additional services → www.sick.com/WFS

	Туре	Part no.
Function Block Factory		
<ul> <li>Description: The Function Block Factory supports common programmable logic controllers (PLCs) from various manufacturers, such as Siemens, Beckhoff, Rockwell Automation and B&amp;R. More information on the FBF can be found <a href="https://fbf.cloud.sick.com" target="_blank">here</a>.</li> <li>Note: You can configure your function block at <a href="https://fbf.cloud.sick.com" target="_blank">Function Block Factory.</a> As a login please use your SICK ID.</li> </ul>	Function Block Factory	On request

# SICK AT A GLANCE

SICK is one of the leading manufacturers of intelligent sensors and sensor solutions for industrial applications. A unique range of products and services creates the perfect basis for controlling processes securely and efficiently, protecting individuals from accidents and preventing damage to the environment.

We have extensive experience in a wide range of industries and understand their processes and requirements. With intelligent sensors, we can deliver exactly what our customers need. In application centers in Europe, Asia and North America, system solutions are tested and optimized in accordance with customer specifications. All this makes us a reliable supplier and development partner.

Comprehensive services complete our offering: SICK LifeTime Services provide support throughout the machine life cycle and ensure safety and productivity.

For us, that is "Sensor Intelligence."

# **WORLDWIDE PRESENCE:**

Contacts and other locations -www.sick.com

